

Endurance Shooting Test Results

Parts Breakage Tabulation

	<u>Part</u>	<u>Gun Failure</u>	<u>At Round</u>	<u>Correction</u>	<u>Comment</u>	<u>Life</u>
#3 Browning 2000	Forearm Cap Buffer	No	2000	Replaced from other gun	Buffer melted - not a fatigue failure.	2000
	Forearm Cap Buffer	No	5000	None	"	3600
#5 Remington 1100	Grip Cap Inlay	No	600	None	Missing after field test	600
	Fore End Liner	No	2000	None	Five tabs broken off	-
	Action Bar Sleeve	No	2000	None	Thin section broken out at top rear.	-
	Locking Block Retainer	No	2000	None	Missing. Locking block no longer captive in bolt assembly.	2000
	Slide Block	No	2000	None	Upper right front corner broken off at operating handle retaining recess.	-
	Firing Pin	Yes	2400	Replaced	Some deformation visible at stop surfaces on locking block.	2400
	Fore End Liner	No	3500	Replaced	Three tabs remain	-
	Link	No	3500	None	3/32" broken off left leg	-

WIL02686