

Endurance Shooting Test Results

Sheet 2

Parts Breakage Tabulation (Continued)

	<u>Part</u>	<u>Gun Failure</u>	<u>At Round</u>	<u>Correction</u>	<u>Comment</u>	<u>Life</u>
#5 Remington (Continued)	Action Bar Sleeve	No	3500	None	Cracked both sides from square notch at rear	-
	Link	Yes	3600	Replaced	Broken link caused fail to lock up	3600
	Piston	Yes	3600	Replaced	Blinds in gas cylinder	3600
	Extractor	Yes	4125	Replaced	Broken	4125
	Firing Pin Retractor Spring	Yes	4500	None	Broken	4500
	Fore End Liner	No	1000	None	Broke at front; freezing magazine cap detent	4500
	Trigger Plate	Yes	4500	Test discontinued	Hammer plunger stuck down - no spring force to drive hammer	4500
#7 Winchester Super X1	Breech Bolt	No	2000	Relieved and chamfered extractor plunger hole to permit continued firing.	Breech bolt peened over extractor plunger hole by extractor. Spring not loading extractor. Gun still operating OK.	-

WAW:T

WIL02687