

RECEIVING AND ESTIMATING REPORT

INITIAL		CUSTOMER ORDER NO.		COMMENTS			
PS							
DATE RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	MODEL AND GRADE		ORDER	
2/17/90	12/20/90	AI 3-88	A6283152	700 25-06 BDL		R 90-33316	
ACCESSORIES							

L/SIGHTS

FROM:		SHIP TO:	
BRENNEMAN, RICHARD RD 3 BOX 356V HUNTINGDON PA 16652		BRENNEMAN, RICHARD RD 3 BOX 356V HUNTINGDON PA 16652	
ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	CLEAN/TEST
		PROM. DATE	ESTIMATED
		VIA	UPS

PAIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL

UN CONDITION:	☐ NEW	☐ SLIGHTLY WORN	☐ VERY WORN	☐ MISUSED	☐ MARRED
---------------	------------------------------	--	------------------------------------	----------------------------------	---------------------------------

CUSTOMER'S REQUEST: *... the trigger is not working as it should it has fired when you push the safety off.*

MAIN FAULT: *Cannot duplicate complaint. However, trigger assembly has been completely readjusted out of factory. Silent misfiring from all adjustment screws 1) trigger pull below spec at 24-2 1/2 pounds, 2) insufficient sear engagement. Trigger does not fully sit on working sear the trigger pull has been backed off too far.*

RTS: *Send repair seat for new trigger assembly at normal cost, as gesture of good-will.*

Rifle is 15 years old

REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY

RD6925 REV. 7/90