

Remington. ML:RT 6/28/88 01 ARMS SERVICE FILE
REMINGTON ARMS COMPANY, INC.
 SPORTING FIREARMS, AMMUNITION, TARGETS AND TRAPS

PLEASE MAIL
 REMITTANCE
 TO BOX CHECKED

WILMINGTON DE 19898

WILMINGTON, DE 19898

WILMINGTON, N. Y. 13357

01-007972-3
 D/A7331235

INVOICE NO. R-98-16624

RECEIPT DATE

Quinta Ace Hardware
 1400 Industrial Blvd.
 Carlsbad AL 36571
 Ref. #917864

98-16624-700

SHIP VIA JTC

CA 4-80

700 24, EBL A601901
 /studs

COMPLAINT: Gun fired when opening and closing bolt. Stock warped.
 MAIN FAULT: Trigger assem. has been improperly adjusted outside
 factory. Trigger pull of .near chamberment excessive, not enough
 over travel. Insufficient over-travel adjustment causes connector
 to sometimes catch on sear-safety arm.

1. 26435 Trigger assem. 1.0.0
2. Could not adjust trigger assem.
3. Polished chamber
4. Check headin
5. Test

TOTAL REPAIR CHARGE	20.00
UP	4.39
TOTAL CHARGES	24.39

CUSTOMER'S SIGNATURE

RECEIVED

ML