

RECEIVING AND ESTIMATING REPORT

CUSTOMER ORDER NO. 917664			COMMENTS JIM STEKL "B"		
DATE RECEIVED 05/31/88	DATE OPENED 06/07/88	DATE CODE CA 4-B0	SERIAL NUMBER A6B919B1	MODEL AND GRADE 700 243 RDL	ORDER 88-16624
ACCESSORIES W/STUDS					

FROM:	SHIP TO:
QUINTS ACE HARDWARE 1406 INDUSTRIAL BLVD SARALAND, AL 36571	QUINTS ACE HARDWARE 1406 INDUSTRIAL BLVD SARALAND, AL 36571

ACCOUNT NUMBER	PROM. DATE	ESTIMATED	VIA UPS
REPAIR CHARGE	TAX ST	INSURANCE	UPS
TAX CITY	PARCEL POST	TOTAL	\$

GUN CONDITION: ☐ NEW ☐ SLIGHTLY WORN ☒ VERY WORN ☐ MISUSED ☐ QUOTE

CUSTOMER'S COMPLAINT
"Gun fired when opening bolt, also when closing bolt"

MAIN FAULT
Trigger assembly has been improperly adjusted outside factory -
Trigger pull $6\frac{1}{2}$ #, rear engagement excessive, not enough overtravel
insufficient over-travel adjustment causes connector
to sometimes catch on cam-safety cam.

PARTS
Re-adjust trigger assembly to factory
specification and re-test - if
necessary, replace trigger assembly & send bill

FOR COMPUTER REF. ONLY	PROOF
	(CLEAN) (TEST) (TARGET)
	REPAIRMAN