

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER
R92-17499INITIAL
FPS

CUSTOMER ORDER NO.

L/FLOOR PLATE, SCREWS

STEEL

DATE RECEIVED
98/20/92DATE OPENED
99/01/92DATE CODE
00 7-78SERIAL NUMBER
A6648299

NEW SERIAL NUMBER

MODEL AND GRADE

700 270 WIN LH

ACCESSORIES

L/MAG BOX

L/WOOD

L/FOLLOWER

L/MAG SPRING

SCOPE BASE

L/SIGHTS

FROM:

SHIP TO:

BULLET HOLE
78 RUTGERS ST
BELLEVILLE

NJ 07109

BULLET HOLE
78 RUTGERS ST
BELLEVILLE

NJ

07109

CUST. NO: 009025 C.O.D

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

WRITE ☐

CLEAN/TEST

PROM. DATE

ESTIMATED

VIA

UPS

GUN CONDITION

- ☐ NEW
☐ LIGHTLY WORN
☐ WORN
☐ VERY WORN
☐ UNREPAIRABLE
☐ MARRED

REPAIR CHARGE

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

CUSTOMER CONCERN

AMMO

FUNCTION

FINISH

ACCURACY

FIT

INSPECT

CYCLE

A1

TRIGGER GROUP

BOLT ASSY.

BARREL ASSY.

REC. ASSY.

WOOD

METAL

MAIN FAULT

Cannot duplicate complaint 1 & 2 above - rifle seems to operate properly however trigger has been improperly adjusted, out of factory - 1) trigger pull above maximum (com. spec. of 15 lbs. measured at 62 lbs)
 2) insufficient over-travel. Also trigger assembly contains an excessive amount of oil, dust, dirt, etc.

ARTS

COMMENTS

1) Offer to clean & readjust present trigger assembly to our specs.
 or
 2) we can install a new trigger group at a normal cost, if that will better our confidence in the rifle

Check out firing pin indent on pin #2 complaint.

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE