

RECEIVING AND ESTIMATING REPORT

CUSTOMER ORDER NO.		COMMENTS ATTN J STEKL			
RECEIVED 31/90	DATE OPENED 02/06/90	DATE CODE DE 9-84	SERIAL NUMBER 7636542	MODEL AND GRADE 7 7MM08	ORDER 90-04878
SERIES W/STUDS		L/SIGHTS			

TO:	SHIP TO:
ROBBY CHANDLER ROUTE 1 CRACKERS NECK BIG STONE GAP VA 24219	ROBBY CHANDLER ROUTE 1 CRACKERS NECK BIG STONE GAP VA 24219

INT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	PROM. DATE	ESTIMATED	VIA UPS
------------	--------------------	--------------------------------	------------	-----------	------------

CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
--------	-----	-----------	-----	-------------	-------

CONDITION:	☐ NEW	☒ SLIGHTLY WORN	☐ VERY WORN	☐ MISUSED	☐ MARRED
------------	------------------------------	---	------------------------------------	----------------------------------	---------------------------------

MER'S REQUEST

Fire on bolt closing

FAULT

Trigger assembly severely contaminated with gummy, oily residue - as - safety cam sticking to side plate of trigger assembly. at time it will not cock, firing pin follows down when bolt closed.

Called customer 2/15/90 and explaining findings. He elected to have us install new trigger assembly at N/C as good will gesture.

1) Install new trigger assembly at N/C

2) charge \$10.00 handling plus return shipping - return C.O.D. 2/15/90 JES

REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

RD6923 REV. 6/88