

M/700 Customer
Complaint

P.I. No GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700
GENERAL CONDITION: NEW R #: 013812
OUTSIDE WORK: SCOPE MOUNTED DATE: 7-12-72
FROM: CHRISTMAN'S INC.
FIRED AMMO TYPE: REMINGTON DARIEN, CT.
& CONDITION: _____ GUN #: 6394467
PROOF: R.E.P. ^{ASSEMBLER 97} INSP.: 74 TEST: _____ CODE: XT = 12/70
HEADING: O.K. GA./CAL.: 222
BREECH OPENING: - CHECKED BY: C. PROSSER
RECOIL SHOULDERS: O.K. APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: 10 ROUNDS - O.K. APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

CONNECTOR - SEAR ENGAGEMENT .010 (MIN. IS .020) TRIGGER
PULL = 2LBS. (MIN. IS 3LBS.) NECK MEASURES .460 (MIN. = .4518)
THROAT IS SHALLOW.

COMPLAINT: "CHAMBER NECK IS TOO SHORT, CHECK TRIGGER AT
LIGHT SETTING"

INCIDENT: POTENTIAL FOLLOW DOWN.

COMMENTS: THIS RIFLE WAS RETURNED QUESTIONING THE FRONT
OF THE CARTRIDGE CASE BEING MARKED, WHICH IS
THE MARK OF THE CASE WIPING ACROSS THE RECEIVER
IN BEING EJECTED. THE LIGHT TRIGGER PULL AND UNDER
MIN. ENGAGEMENT COULD HAVE LED TO A MORE SERIOUS
COMPLAINT LATER.