

ORDER
R 74-16802

RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	NEW SERIAL NUMBER	MODEL AND GRADE
/25/94	05/26/94	WU 8-71	6468752		700 30-06 BDL
SSORIES	SLING STRAP	W/STUDS	W/SWIVELS	SCOPE BASE	

TO:		SHIP TO:	
COOPER, THOMAS E.		COOPER, THOMAS E.	
1700 1 WILLIAMS CTR.		1700 1 WILLIAMS CTR.	
TULSA	OK 74172	TULSA	OK 74172

L <u>059015</u>		CUST NO: 097858 C.O.D L	
QUANTITY	ACCOUNT NUMBER N/C	PROM. DATE	ESTIMATED
	<u>059001</u>		
WRITE ☐		VIA UPS	

CONDITION		REPAIR CHARGE
IEW		EXCISE
IGHTLY WORN		TAX
ORRN		INSURANCE
ERY WORN		UPS
INREPAIRABLE		PARCEL POST
1ARRRD		TOTAL

CUSTOMER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT
LE	A1	B1				
AGER GROUP	<i>"Discharged when safety was released."</i>					F1
ASSY.		B3			E2	F2
REL ASSY.		B4		D1	E3	F3
ASSY.		B5		D2	E4	F4
OD			C1	D3	E5	F5
AL			C2			

FAULT Upon receipt, we were unable to duplicate customer's concern. Trigger pull measured at 3.5-4 LBS. Gear lift .010. Trigger adjusting screw and trigger stop screw have been re-set. Kind of factory as sealant is missing. Minimum overhauls replace trigger assembly at r/c to customer as gesture of good-will. Gun buff 8-71. TN 5-26-94

[illegible]

OFFICE COPY

RD6925 REV. 1/94