

Customer Complaint

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 660
 GENERAL CONDITION: NEW R # : 27164
 OUTSIDE WORK: SCOPE MOUNTED DATE: 12-28-71
 FIRED AMMO TYPE: - FROM: J.W. CUMMINGS, SR.
 & CONDITION: _____ AVERILL PARK, N.Y.
 PROOF: R.E.P. INSP.: 97 TEST: 13 GUN # : 127752
 CODE: PR = 6/68
BU = 1/71
RU = 1/71
 HEADING: O.K. GA./CAL.: 350 REM. MAG.
 BREECH OPENING: - CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

NO DAMAGED, BROKEN COMPONENTS.

SEAR-TRIGGER CONNECTOR ENGAGEMENT .025, TRIGGER
PULL 5 POUNDS - CREEPS. TOO MUCH - TOO HEAVY
LUBRICATION IN HOUSING ASSEMBLY. TRIGGER RIDES
LEFT INSIDE OF HOUSING.

COMPLAINT: CREEPY TRIGGER PULL. RIFLE FIRED WHEN
BOLT HANDLE WAS RAISED.

INCIDENT: FOLLOW DOWN.

COMMENTS: THE CUSTOMERS MALFUNCTION, FOLLOWS DOWN,
COULD NOT BE DUPLICATED. THE EXCESSIVE LUBRICATION
WITH THE TRIGGER RIDING THE INSIDE WALL OF THE
HOUSING COULD CAUSE THE MALFUNCTION ESPECIALLY
IN COLD WEATHER.