

Cust Gngl.

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 ADL
GENERAL CONDITION: GOOD R #: 000130
OUTSIDE WORK: SCOPE MOUNTED, BUTT PAD DATE: 1-11-73
FITTED. FROM: ESTELL CURRY
FIRED AMMO TYPE: _____ GATESVILLE, TEXAS
& CONDITION: _____ GUN #: 165224
PROOF: R.E.P. ASSEMBLER 6 INSP.: D TEST: 87 CODE: WM = 8/65
HEADING: - GA./CAL.: 243 WIN.
BREECH OPENING: - CHECKED BY: C. PROSSER
RECOIL SHOULDERS: O.K. APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: NO APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

STEEL CHIPS BETWEEN TRIGGER AND CONNECTOR.
HARDENED LUBRICANT AROUND SEAR. EVIDENCE OF
FIRING PIN HEAD CATCHING ON REAR-LEFT CORNER
OF HOUSING.

COMPLAINT: FIRED AS BOLT WAS UNLOCKED

INCIDENT: FOLLOW DOWN

COMMENTS: THE CHIPS BETWEEN TRIGGER AND CONNECTOR
CAUSE SEAR-CONNECTOR ENGAGEMENT TO VARY,
LEADING TO FOLLOW-DOWN. THE HARDENED
LUBRICANT AND FIRING PIN HEAD-HOUSING INTER-
FERANCE ALSO CONTRIBUTE TO FOLLOW-DOWN
MALFUNCTIONS.