

RECEIVING AND ESTIMATING REPORT

DATE RECEIVED 1/15/90	DATE OPENED 1/15/90	DATE CODE 100	SERIAL NUMBER 100	MODEL AND GRADE 200MMAG	BDL	R
ACCESSORIES 7 STUDS		SCOPE BASE L REAR SIGHT				
FROM: DAVID D'ISIDORO RD 1 BOX 201 SMOCK PA 15480				SHIP TO: DAVID D'ISIDORO RD BOX 201 SMOCK PA 15480		
ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	PROM. DATE	ESTIMATED	VIA UPS	
REPAIR CHARGE TAX INSURANCE UPS PARCEL POST TOTAL						
GUN CONDITION: ☐ NEW ☒ SLIGHTLY WORN ☐ VERY WORN ☐ MISUSED ☐ MARRED CUSTOMER'S REQUEST "It has a delayed action when fired and it discharges when the bolt is closed". MAIN FAULT Customer's complaint was duplicated with rifle in as-received condition. Subsequent disassembly of rifle revealed semi-safety cam sticking to housing side plate. Inside of assembly contaminated with gummy sticky residue (also present on bolt stop). PARTS 1) Per phone call to customer 1/23/90 - replace trigger assembly at no-charge, as good-will gesture 2) Charge \$10.00 handling and return shipping 1/23/90 JLS						
DEPARTMENT JLS	PROOF	CLEAN	TEST	TARGET	PATTERN	
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE	

RD6925 REV. 6/88