

Cust. Copy

P.I. No GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 ADL
GENERAL CONDITION: GOOD R #: 024437
OUTSIDE WORK: SCOPE MOUNTED, RECOIL PAD DATE: 11-22-72
ADDED, FROM: DONALDSON'S GUNSHOP
FIRED AMMO TYPE: _____ MINNEAPOLIS, MINN.
& CONDITION: _____ GUN #: 309624
PROOF: R.E.P. ASSEMBLER GS INSP.: 96 TEST: 87 CODE: EP = 10/67
HEADING: O.K. GA./CAL.: 3006
BREECH OPENING: _____ CHECKED BY: C. PROSSER
RECOIL SHOULDERS: O.K. APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: NO APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

CONNECTOR CLEARANCE ON TRIGGER .003 UNDER MIN.
BURRS ON SIDES OF TRIGGER. HOUSING PROTRUDES
INTO FIRING PIN HEAD SLOT. SEAR-TRIGGER CONNECTOR
ENGAGEMENT .025

COMPLAINT: FIRE UPON LOCKING THE BOLT.

INCIDENT: FOLLOW DOWN

COMMENTS: THE CUSTOMER'S MALFUNCTION CAN NOT BE
DUPLICATED AND THERE IS NO EVIDENCE OF SUCH
MALFUNCTION, HOWEVER, THE TRIGGER BURRS,
EXCESSIVE TRIGGER-TRIGGER CONNECTOR CLEARANCE,
AND HOUSING PROTRUDING COULD CONTRIBUTE TO
SUCH A MALFUNCTION.