

Customer Complaint

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 ADL
 GENERAL CONDITION: NEW R #: 001648
 OUTSIDE WORK: SCOPE MOUNTED, SWIVELS & RECOIL PAD FITTED. DATE: 1-26-72
 FIRED AMMO TYPE: - FROM: DUNN'S SPG. GDS. INC.
PEVELY, MISSOURI
 & CONDITION: _____ GUN #: 332321
 PROOF: R.E.P. ASSEMBLER P INSP.: D TEST: 49 CODE: BL = 1/64
 HEADING: O.K. GA./CAL.: 3000 S&W
 BREECH OPENING: - CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

NO DAMAGED, BROKEN COMPONENTS. GEAR-CONNECTOR
ENGAGEMENT .010 (MIN. = .020) TRIGGER PULL = 3½ (MIN. = 3 LBS.)
TRIGGER CLEARANCE ON CONNECTOR 1.087 M/D = 1.080
CONNECTOR CLEARANCE ON TRIGGER 1.073 M/D = 1.076
(.014 CLEARANCE WHERE .007 IS MAX.)

COMPLAINT: FIRES WHEN SAFE IS RELEASED

INCIDENT: CONNECTOR FAILS TO RETRACT.

COMMENTS: THE EXCESSIVE CLEARANCE BETWEEN CONNECTOR
AND TRIGGER ALLOWS THE CONNECTOR TO CREEP UP INTO
AN INTERFERENCE POSITION WHERE IT FAILS TO RETRACT
WITH THE SAFETY ON. WHEN THE SAFETY IS
RELEASED THE FIRING PIN FOLLOWS DOWN.