

RECEIVING AND ESTIMATING REPORT							
INITIAL				CUSTOMER ORDER NO.			
LIM				ATT. J. KAST			
DATE RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	MODEL AND GRADE	MTN	ORDER	
09/14/88	09/22/88	YF 12-B5	86762876	700 280	MTN	R	88-2A918
ACCESSORIES		W/STUDS		SCOPE BASE			
FROM:				SHIP TO:			
EMERSON AND SON, INC.				EMERSON AND SON, INC.			
28 STATE ST.				28 STATE ST.			
GROVETON, N.H.				GROVETON, N.H.			
				03582			
ACCOUNT NUMBER		ACCOUNT NUMBER N/C		FROM DATE		ESTIMATED	
						VIA	
		WRITE ☐				UPS	
REPAIR CHARGE TAX INSURANCE UPS PARCEL POST TOTAL							
GUN CONDITION: ☐ NEW ☒ SLIGHTLY WORN ☐ VERY WORN ☐ MISUSED ☐ MARRED							
CUSTOMER'S REQUEST: <i>I found that the trigger does not return after every shot and consequently on the following round the gun would discharge upon moving the safety to the fire position.</i>							
MAIN FAULT: <i>Trigger has been removed from fire control assembly and improperly replaced outside of factory, causing a bind in the housing. (2) trigger adjustment and overtravel screws have also been improperly adjusted outside of factory.</i>							
PARTS				<i>Based upon Dealer comments about gunning for service in attached correspondence, replace trigger assembly at no-charge.</i> <i>9/22/88</i> <i>Jds</i>			
REPAIRMAN				PROOF			
GALLERY TESTER				DATE			
CLEAN				TEST			
DATE				DATE			
TARGET				PATTERN			
DATE				DATE			

OFFICE COPY

BOMF23 REV. 6/88