

Cust. Complaint

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 ADL
 GENERAL CONDITION: GOOD R #: 002805
 OUTSIDE WORK: SWIVELS AND SCOPE MOUNT- DATE: 2-1-73
ED. FROM: FULKS SPORTING
GOODS INC.
 FIRED AMMO TYPE: - CLARKSBURG, W.VA.
 & CONDITION: _____ GUN #: 6247427
 PROOF: R.E.P.-A ^{ASSEMBLER 14} INSP.: 73 TEST: 87 CODE: KS = 5/69
 HEADING: O.K. GA./CAL.: 270 WIN.
 BREECH OPENING: - CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

SEAR-TRIGGER CONNECTOR ENGAGEMENT .010 (MIN. IS .020)

CONNECTOR CLEARANCE ON TRIGGER = 1.069 (MODEL = 1.076)
DRAWING = 1.079

4 OF TRIGGER PIN HOLE TO TOP OF TRIGGER = .974 (.973)
.971

COMPLAINT: "FIRES WHEN SAFETY IS MOVED TO FIRE POSITION."

INCIDENT: FOLLOW DOWN

COMMENTS: THE EXCESSIVE MOVEMENT BETWEEN TRIGGER &
TRIGGER CONNECTOR WILL ALLOW INTERFERENCE
BETWEEN THE SEAR AND CONNECTOR WHICH PREVENTS
RETRACTION INTO COCKED POSITION. THE PRESENCE
OF HARDENED LUBRICANT INCREASES THE POSSIBILITY
OF A MALFUNCTION.