



5/3/94

Leonard Halmon *Handwritten signature*
 Claims FIRED ON Bolt closing 60 minutes
 R 94 14700

- Bolt Stop Stock when depressed would not return
- Trigger pull measured $5\frac{1}{2}$ LBS as rec'd
- Seal lift measured .0085
- Sides of trigger were gummy & sticky
- Components appeared to be in good condition
- Was a 'light' off safe
- ~~Revised~~ Overtravel screw slot broken, trigger may have been adjusted and resealed.

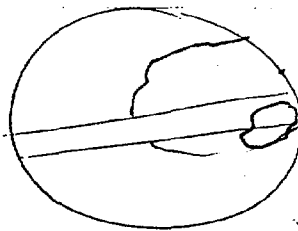

chip under
sealant

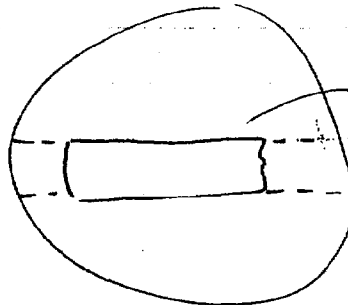

Sealant missing
on rear engagement
screw as shown