

Customer Complaint.

P.I. No GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 ADL
GENERAL CONDITION: NEW R #: 06640
OUTSIDE WORK: No DATE: 3-9-71
FROM: JOE W. HARRIS
FIRED AMMO TYPE: - VICTORIA, TEXAS.
& CONDITION: _____ GUN #: 6364870
PROOF: R.E.P.-A INSP.: 0 TEST: 13 CODE: WT = 11/70
HEADING: O.K. GA./CAL.: 270 WIN.
BREECH OPENING: _____ CHECKED BY: C. PROSSER
RECOIL SHOULDERS: O.K. APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: No APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____
NO BROKEN OR DAMAGED COMPONENTS

COMPLAINT: FIRED WHEN SAFETY WAS PUSHED OFF.

INCIDENT: FOLLOWED DOWN

COMMENTS: CONNECTOR-SEAR ENGAGEMENT .010, MIN. IS .015
THIS COUPLED WITH A TOO HEAVY LUBRICANT AND SLIGHTLY
ROUNDED SEAR, PROBABLY LED TO THE MALFUNCTION.
THE MALFUNCTION COULD NOT, HOWEVER, BE
DUPLICATED HERE.

ENGAGEMENT RE-ADJUSTED TO .015.