

DON'T SAY IT-WRITE IT

D.J. SANITA ARMS SERVICE 52-2 R11
J.A. STEKL PRODUCT SERVICE 52-4 2
R-04240 M/700 BDL 30/06 CAL. RIFLE, SERIAL #A6334914 3/31/80

Please replace the trigger assembly on this rifle and return to:

Mr. G.A. Hernandez
 6430 Newborn Drive
 College Park, Georgia 30337

Keep the old trigger assembly on file for possible future reference.

Please complete the work and return rifle, via U.P.S., as soon as possible.

Thank you.

Jim:tpb



1 773

STOP. LOOK. AND LIVE

The general condition of the gun appeared to be somewhat worn and it was noted that a scope had been mounted after it originally left our factory. In going over the individual parts, we found headspace normal, recoil shoulders normal, and chamber normal.

Examination of the rifle and trigger assembly could not duplicate the incident you have described. All parts tolerances and dimensions were found to be normal, including sear-connector engagement. However, it appears that the trigger adjustment screws have been altered outside of our company, as evidenced by the sealant having been removed from them, and over-travel was excessive; trigger pull was within our specifications at 14 pounds.

Based on our findings, Remington Arms Company, Inc., cannot accept any liability or responsibility for the incident. When the safety is in the "on safe" position, the sear is lifted off of the trigger connector. At this time, very little effort is required to pull the trigger rearward, allowing the connector to be moved away from under the sear and, in this condition, on moving the safety to the "fire" position, the rifle will fire if the trigger is touched.