

NOTHING ADDITIONAL FOUND THAT WOULD ACCOUNT FOR CUSTOMER'S STATED PROBLEM WITH THIS RIFLE FIRING UPON CLOSING. COULD NOT DUPLICATE THE PROBLEM EVEN BY TRICK-TESTING.

HOWEVER, TWO CAUSES JUSTIFYING THE CUSTOMER'S COMPLAINT ABOUT BOLT SEIZURE WERE LOCATED, THE EXTRACTOR PROTRUDES FROM UNDER THE BOLT SHROUD AND WOULD CAUSE CLOSING DIFFICULTY. ALSO, THERE IS A FLAW PRESENT IN THE RECEIVER AT THE RECOIL SHOULDERS. THIS FLAW CAUSES THE BOLT LUGS TO BIND, EVEN WITH THE FIRING PIN REMOVED. IF THE FLAW IS NOT REMOVEABLE, I FEEL THE ACTION SHOULD BE REPLACED.

RJW
4/27/83