

Gordon Kasper

R- 9414311

Fixes when safety is taken off

Unable to duplicate customers concern as rec'd.

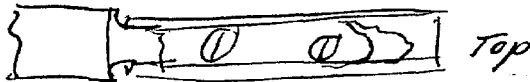
• Trigger pull 2 to 2 1/4 lbs as rec'd

• Seal lift .0095

• Stack glass bedded

• Trigger Assy full of grease like substance, unable to see thru inspection hole in trigger Assy side plate

• Trigger has been adjusted outside of factory

• pounds pull and over travel backed out and re sealed
some sealant put on over original factory• Seal engagement reduced to point that .010
microscopic measurement