

M/700 Customer Complaint

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700
GENERAL CONDITION: GOOD R #: 014720
OUTSIDE WORK: SCOPE MOUNTED, BUTT PLATE DATE: 7-24-72
CHANGED TO RECOIL PAD. FROM: S.R. MAYHOUL
FIRED AMMO TYPE: - MELBOURN, FLA.
& CONDITION: _____ GUN #: 357864
PROOF: R.E.P. INSP.: 0 TEST: 87 CODE: RP = 11/67
HEADING: O.K. GA./CAL.: 3006
BREECH OPENING: - CHECKED BY: C. PROSSER
RECOIL SHOULDERS: O.K. APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: NO APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

TRIGGER ADJUSTING SCREWS NOT SEALED (NO INDICATION
THE EVER WERE), ENGAGEMENT SEAR TO TRIGGER CONNECTOR
.020, TRIGGER PULL ALBS. TRIGGER RUBS ON GUARD.
GREASE LIKE LUBRICANT ON TRIGGER INSIDE HOUSING.

COMPLAINT: FIRES WHEN THE SAFETY IS THROWN OFF.

INCIDENT: FOLLOW DOWN

COMMENTS: THE HEAVY LUBRICANT COMBINED WITH FRICTION
OF THE TRIGGER AGAINST THE TRIGGER GUARD
CAUSED TRIGGER RETRACTION TO BE ERRATIC,
RESULTING IN FOLLOW DOWN.