

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER
R 92-02568

INITIAL CUSTOMER ORDER NO.

W/1 SPENT CASE

DATE RECEIVED

DATE OPENED

DATE CODE

SERIAL NUMBER

NEW SERIAL NUMBER

MODEL AND GRADE

01/14/92

01/21/92

DQ 9-77

A6659392

700 6MM

ADL

ACCESSORIES

W/STUDS

SCOPE BASE

L/SIGHTS

FROM

SHIP TO:

MCCLELLANDS GUN SHOP
DIVISION OF REMCO
1533 CENTERVILLE ROAD
DALLAS TX 75228

MCCLELLANDS GUN SHOP
DIVISION OF REMCO
1533 CENTERVILLE ROAD
DALLAS TX 75228

CUST NO: 006612 WILM

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

WRITE ☐

CLEAN/TEST

PROM. DATE

ESTIMATED

VIA

2-4-92

UPS

GUN CONDITION

☐ NEW

☐ LIGHTLY WORN

☐ WORN

☐ VERY WORN

☐ UNREPAIRABLE

REPAIR CHARGE

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

CUSTOMER CONCERN

AMMO

FUNCTION

FINISH

ACCURACY

FIT

INSPECT

CYCLE

A1

B1

TRIGGER GROUP

BOLT ASSY.

B3

BARREL ASSY.

B4

REC. ASSY.

B5

WOOD

C1

METAL

C2

E1

E2

E3

E4

E5

F1

F2

F3

F4

F5

MAIN FAULT

Cannot duplicate reported malfunction - Trigger assembly and safety operate properly. However, the trigger assembly has been improperly adjusted outside factory (as evidenced by no adjust on all adjusting screws outside Remington specifications: 1) trigger pull 2-3/4 pounds 2) insufficient rear engagement, 3) insufficient over-travel.

Sear-left .008"

PARTS

COMMENTS

Offer new trigger assembly at 1/2 normal cost, as a gesture of good-will

REPAIRMAN

PROOF

CLEAN

TEST

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE

OFFICE COPY

REV. 6/91