

Page (3) of (4)

mm-81

MOD. 700R# 01224Ser. No. 4250346P.I. 8:Recd. 1-6-83MFD. 7-69Classified By RLH/lmNumber 1

COMMENTS:

7-18-83

Upon disassembling the gun to subassemblies, the following observations were made:

① There was a bright colored upset on the front action edge of the bolt plug approximately $\frac{1}{4}$ " right of the firing pin head slot center line.

② The engagement surface of the firing pin head appeared to be relatively rough.

③ There was quite a lot of debris (oil & dirt & grease) on and around the trigger housing assembly.

④ Some scaling was observed on the left rear of the bolt hole at the receiver tang.

The trigger housing assembly was removed from the barreled action and the following observations were made:

⑤ The bolt lock appeared to have a relatively large radius on top.

⑥ A fine grit was evident within the trigger housing assembly (looked like oil & dirt).

⑦ All screws were tightly sealed.

The trigger housing assembly was disassembled and the following observations were made:

⑧ There was a small amount of clearance between the top of the trigger and the back of the connector when the connector was seated downward on the trigger.