

Rev. 2-15-61

660  
~~700~~ Customer Complaint

P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 660  
GENERAL CONDITION: GOOD R #: 018859  
OUTSIDE WORK: NO DATE: 10-3-72  
FROM: GEO. ORNDUFF  
FIRED AMMO TYPE: - NEW MARTINSVILLE, W. VA.  
& CONDITION: \_\_\_\_\_ GUN #: 131278  
PROOF: R.E.P. <sup>ASSEMBLY 18</sup> INSP.: U TEST: 13 CODE: AR= 3/68  
HEADING: O.K. GA./CAL.: 243 WIN.  
BREECH OPENING: - CHECKED BY: C. PROSSER  
RECOIL SHOULDERS: O.K. APPROVED: \_\_\_\_\_  
CHAMBER: O.K. APPROVED: \_\_\_\_\_  
TEST: NO APPROVED: \_\_\_\_\_  
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

HOUSING CUT IN RECEIVER OFF CENTER.ENGAGEMENT BETWEEN CONNECTOR & SEAR, 0.35 (MIN. IS 0.20). EXCESSIVE LUBRICANT INSIDE TRIGGER ASSEMBLY.

COMPLAINT: DISCHARGED WHEN SAFETY WAS MOVED FROM ON TO OFF.

INCIDENT: FOLLOW DOWN

COMMENTS: THE MALFUNCTION MAY HAVE BEEN CAUSED BY THE FIRING PIN HEAD CATCHING ON THE EXPOSED SIDE OF THE HOUSING INSTEAD OF SEATING ON THE SEAR THE RESULTING BURR IN THE HOUSING CAN CAUSE THE SEAR TO STICK.