

Rev. 2-15-61

Carl Conys.

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 BDL
GENERAL CONDITION: GOOD R #: 022218
OUTSIDE WORK: SCOPE MOUNTED. TRIGGER DATE: 11-10-72
PULL WEIGHT CHANGED. FROM: JOHN PAYNE
FIRED AMMO TYPE: _____ MT. VIEW, ARK.
& CONDITION: _____ GUN #: 6504815
PROOF: R.E.P.-M INSP.: U TEST: 13 CODE: XU = 12/71
HEADING: O.K. GA./CAL.: 222
BREECH OPENING: _____ CHECKED BY: C. PROSSER
RECOIL SHOULDERS: EXCESSIVE RADIUS REAR-LUGS. APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: NO APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

SEAR-TRIGGER CONNECTOR ENGAGEMENT .025 (ADJUST-
MENT UNDISTURBED) TRIGGER STOP & ADJUSTING SCREWS
SEALS BROKEN. TRIGGER CONNECTOR WARPED.

COMPLAINT: RIFLE FIRED WHEN SAFETY WAS PUSHED OFF.

INCIDENT: FOLLOW DOWN.

COMMENTS: WITH THE TRIGGER PULL REDUCED TO TWO POUNDS
TRIGGER CONNECTOR RETRACTION WOULD BE ERRATIC.
THE WARPED CONNECTOR ALSO WOULD CAUSE ERRATIC
ENGAGEMENT AND COULD RESULT IN FOLLOW DOWN.
REMINO CUSTOMER REMINGTON DOES NOT
RECOMMEND UNDER THREE POUND TRIGGER PULL.