

11/100 Customer Complaint

P.I. No GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 VARMINT
 GENERAL CONDITION: NEW R #: 014137
 OUTSIDE WORK: FRONT TRIGGER ADJUSTING DATE: 7-13-72
SCREWS ADJUSTED. FROM: H.L. PETERS INC.
BUFFALO, N.Y.
 FIRED AMMO TYPE: — GUN #: 6519891
 & CONDITION: _____ LW = 2/72
 PROOF: R.E.P.-M INSP.: 48 TEST: 44 CODE: PW = 6/72
 HEADING: — GR./CAL.: 25-06 REM.
 BREECH OPENING: — CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: No APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

CONNECTOR - SEAR ENGAGEMENT .010 (MIN. = .020) TRIGGER
ADJUSTING SCREW BACKED OUT ELIMINATING SPRING TENSION
REQUIRED TO RETRACT TRIGGER & TRIGGER CONNECTOR.

COMPLAINT: FIRES WHEN CLOSING BOLT

INCIDENT: FOLLOW DOWN

COMMENTS: APPARENTLY THE CUSTOMER, ATTEMPTING TO
ADJUST THE TRIGGER PULL, BACKED THE ADJUSTING
SCREW OUT TOO FAR WHICH ELIMINATED ALL SPRING
TENSION. WITHOUT THIS, THE TRIGGER AND CONNECTOR
FAILED TO RETRACT RESULTING IN FOLLOW DOWN.