

RECEIVING AND ESTIMATING REPORT ✓

INITIAL		CUSTOMER ORDER NO.		COMMENTS: ATTN J STEKL			
JM							
DATE RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	MODEL AND GRADE		ORDER	
9/07/90	09/19/90	DR 9-68	368540	700 30-06 EDL		R 90-24158	
ACCESSORIES		SCOPE BASE					

FROM: RAYCO SALES
9105 MENDENHALL MALL RD
JUNEAU AK 99801

SHIP TO: RAYCO SALES
9105 MENDENHALL MALL RD
JUNEAU AK 99801

ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	PROM. DATE	ESTIMATED	VIA
					V409556133

PAIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL

UN CONDITION: ☐ NEW ☐ SLIGHTLY WORN ☒ VERY WORN ☒ MISUSED ☐ MARRED

CUSTOMER'S REQUEST: "This rifle discharged while the owner was raising the bolt handle to extract a cartridge"

MAIN FAULT: Rifle has not been properly maintained - trigger assembly is contaminated with oil and gumming residue (as is bolt & firing pin assembly). Movement of internal trigger parts is sluggish, even at room temperature. Cold temperature combined with contamination could possibly cause mal-function. Trigger pull 4#, near-lift 1008". Could not duplicate complaint.

Clean trigger assembly, if possible. If not, send quotation for replacement trigger assembly at $\pm$ normal price, as gesture of good-will.

9/21/90
JMS

REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

RD6925 REV. 6/88

OFFICE COPY