

RECEIVING AND ESTIMATING REPORT

INITIAL FPS		CUSTOMER ORDER NO.		COMMENTS W/BTM OF SEE THRU SCOPE MOUNT	
DATE RECEIVED 01/10/91	DATE OPENED 01/16/91	DATE CODE	SERIAL NUMBER B6210700	MODEL AND GRADE 700 30-06 BDL	ORDER R 91-0162
ACCESSORIES W/STUDS					

KA 5-80 2ND TIME IN

FROM: REIMER, ROBERT
249 MAIN ST
SLATINGTON PA 18080

SHIP TO: REIMER, ROBERT
249 MAIN ST
SLATINGTON PA 18080

ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐ CLEAN/TEST	PROM. DATE	ESTIMATED 1-24-91	VIA UPS
----------------	--------------------	---	------------	----------------------	------------

REPAIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
---------------	-----	-----------	-----	-------------	-------

GUN CONDITION: ☐ NEW ☐ SLIGHTLY WORN ☐ VERY WORN ☐ MISUSED ☐ MARRED

CUSTOMER'S REQUEST

Firing pin didn't hit primer, shell went off
when opening Bolt. Gun jammed.
Gun (unsafe) to use.

MAIN FAULT

Cannot duplicate above complaints. Trigger and safety assembly
operate normally. Trigger pull 7.5 lbs. semi-left "0000". Trigger assembly
and firing pin assembly are dripping wet with excessive lubricants.
The excessive lubrication in the firing pin assembly, coupled with cold
weather, could explain the problems encountered - improper maintenance.

PARTS

1) Clean inside of bolt and trigger assembly if
possible.
2) Option for replacement trigger assembly at
normal cost, assurance of good will if it
will restore your confidence in the rifle.
Scope Mounts in Box

REPAIRMAN RBS	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY

6925 REV. 7/90