

Rev. 2-15-61

Customer Complaint

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 BDL
 GENERAL CONDITION: NEW R #: 27287
 OUTSIDE WORK: NO DATE: 11-23-70
 FROM: SEARLE ELEC. CO.
 FIRED AMMO TYPE: - VERNAL, UTAH
 & CONDITION: _____ GUN #: 6296977
 PROOF: R.E.P.A INSP.: 74 ASSEMBLER 13 TEST: 55 CODE: LT = 2/70
 HEADING: - GA./CAL.: 3006
 BREECH OPENING: - CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: - APPROVED: _____
 CHAMBER: - APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

TRIGGER / CONNECTOR CLEARANCE -.003 OUTSIDE MODEL
DRAWING; CONNECTOR; TRIGGER CLEARANCE +.005 OUTSIDE
MODEL DRAWING. THIS ADDS UP TO .008 MORE MOVE-
MENT UP, OF CONNECTOR THAN THERE SHOULD BE TO
POSSIBLE INTERFERENCE WITH THE SEAR.

COMPLAINT: "TRIGGER FIRES SOMETIMES WHEN TAKEN OFF
SAFE." (EXTRACTOR FAULTY)

INCIDENT: FOLLOWS DOWN WHEN SAFE IS PUSHED OFF.

COMMENTS: THE FOLLOWS DOWN MALFUNCTION COULD NOT
BE VERIFIED ALTHOUGH EXCESSIVE CONNECTOR
MOVEMENT IS PRESENT.
EXTRACTOR CLAW DAMAGED.