

## RECEIVING AND ESTIMATING REPORT

W/ BOTTOM HALF OF SEE THRU MNTS

R 92-18838

|                           |                         |                      |                           |                   |                                  |
|---------------------------|-------------------------|----------------------|---------------------------|-------------------|----------------------------------|
| INITIAL<br>FJB            | CUSTOMER ORDER NO.      |                      |                           |                   |                                  |
| DATE RECEIVED<br>09/09/92 | DATE OPENED<br>09/18/92 | DATE CODE<br>LI 2-76 | SERIAL NUMBER<br>A6268583 | NEW SERIAL NUMBER | MODEL AND GRADE<br>700 30-06 ADL |
| ACCESSORIES<br>W/STUDS    |                         |                      |                           |                   |                                  |

|                                                           |                                                           |
|-----------------------------------------------------------|-----------------------------------------------------------|
| FROM:                                                     | SHIP TO:                                                  |
| SHYDAS GUN SHOP<br>1635 S LINCOLN AVE<br>LEBANON PA 17042 | SHYDAS GUN SHOP<br>1635 S LINCOLN AVE<br>LEBANON PA 17042 |

CUST NO: 005936 WILM

|                                       |                    |                                           |               |           |         |
|---------------------------------------|--------------------|-------------------------------------------|---------------|-----------|---------|
| ACCOUNT NUMBER                        | ACCOUNT NUMBER N/C | WRITE <input type="checkbox"/> CLEAN/TEST | PROM. DATE    | ESTIMATED | VIA UPS |
| GUN CONDITION                         |                    |                                           | REPAIR CHARGE |           |         |
| <input type="checkbox"/> NEW          |                    |                                           | EXCISE        |           |         |
| <input type="checkbox"/> LIGHTLY WORN |                    |                                           | TAX           |           |         |
| <input type="checkbox"/> WORN         |                    |                                           | INSURANCE     |           |         |
| <input type="checkbox"/> VERY WORN    |                    |                                           | UPS           |           |         |
| <input type="checkbox"/> UNREPAIRABLE |                    |                                           | PARCEL POST   |           |         |
| <input type="checkbox"/> MARRED       |                    |                                           | TOTAL         |           |         |

| CUSTOMER CONCERN | AMMO | FUNCTION | FINISH | ACCURACY | FIT | INSPECT |
|------------------|------|----------|--------|----------|-----|---------|
| CYCLE            | A1   | B1       |        |          |     |         |
| TRIGGER GROUP    |      | B2       |        |          |     | F1      |
| TRIGGER ASSY.    |      | B3       |        |          | E2  | F2      |
| BARREL ASSY.     |      | B4       |        | D1       | E3  | F3      |
| REC. ASSY.       |      | B5       |        | D2       | E4  | F4      |
| WOOD             |      |          | C1     | D3       | E5  | F5      |
| METAL            |      |          | C2     |          |     |         |

As received, rifle would not cock when bolt was closed. Firing pin simply followed down on cocking cam. Disassembly of rifle revealed trigger mechanism had been improperly adjusted out of factory (excessive main spring tension screws). 1) trigger pull felt over 2 lbs. 2) Sear engagement inadequate. No retraction spring force on trigger, due to improper adjustment. Trigger pull 2 1/2 pounds; sear lift 0.11"

|                |                                                                                                                       |
|----------------|-----------------------------------------------------------------------------------------------------------------------|
| PTS            | COMMENTS                                                                                                              |
|                | Since sear engagement has been tampered with, offer new trigger assembly at 1/2 normal cost, as gesture of good-will. |
| REPAIRMAN      | PROOF                                                                                                                 |
| CLEAN          | TEST                                                                                                                  |
| TARGET         | PATTERN                                                                                                               |
| GALLERY TESTER | DATE                                                                                                                  |
| DATE           | DATE                                                                                                                  |
| DATE           | DATE                                                                                                                  |