

RECEIVING AND ESTIMATING REPORT

COMMENTS

*to Product Service*ORDER
R 94-06409

CUSTOMER ORDER NO.

RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	NEW SERIAL NUMBER	MODEL AND GRADE
15/94	02/21/94	KI 5-88	C6260561		700 270 ADL
SRIES W/STUDS					

Set up file
L/REAR SIGHT

SHIP TO:

VASS-KAPP HARDWARE & FURN
PO BOX 107
CORNER MAIN & GRAYSON ST
GALAX VA 24333

VASS-KAPP HARDWARE & FURN
PO BOX 107
CORNER MAIN & GRAYSON ST
GALAX VA 24333

CUST NO: 007000 ILIONL

ITEM NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	PROM. DATE	ESTIMATED	VIA
					UPS
CONDITION	<i>Appearance of exterior</i> <i>5P Trigger 15.00</i> <i>clean 5.00</i> <i>Adj. H space NB</i> <i>" inletting NB</i> <i>skip 8.00</i>				REPAIR CHARGE <i>20.00</i> EXCISE TAX INSURANCE UPS <i>8.00</i> PARCEL POST TOTAL <i>28.00</i>

OWNER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT
	A1	B1	<i>Unable to close bolt on Remington Ammunition</i> <i>Find on bolt closing</i>			
ER GROUP						
SSY.		B3		E2	F2	
L ASSY.				E3	F3	
SSY.		B5		E4	F4	
			C1	D3	E5	F5
			C2			

GUN Mfg. 5-88 Unable to duplicate customer's complaint - gun will not spring fire or malfunction in any manner. Removed action from stock - underside of action and trigger Assy loaded with debris. Firing pin head, connector and sear gummed up with shellac like substance. Improper care and maintenance. Clean action. Increase headspace. Adjust inletting and replace trigger Assy at special price as gesture of good will.

COMMENTS

Trigger pull measured 6# as Recd
5# as 1st was .012
Perform all new gun inspections
FOR FUNCTION.

REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
-----------	-------	-------	------	--------	---------