

RECEIVING AND ESTIMATING REPORT

INITIAL		CUSTOMER ORDER NO.		COMMENTS	
DATE RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	MODEL AND GRADE	ORDER
9/07/90	09/19/90	00 7-77	A6485963	700 30-06	R 90-24163
ACCESSORIES		L/MAG BOX	L/WOOD	L/FOLLOWER	L/MAG SPRING L/SIGHTS
		L/ FLOOR PLATE			

FROM:	SHIP TO:				
VILLMANN, ALAN E LEXINGTON HILL CONDO I-2 HARRIMAN NY 10926	VILLMANN, ALAN E LEXINGTON HILL CONDO I-2 HARRIMAN NY 10926				
ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	PROM. DATE	ESTIMATED	VIA
					V437818695

REPAIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
---------------	-----	-----------	-----	-------------	-------

SUN CONDITION:	☐ NEW	☐ SLIGHTLY WORN	☐ VERY WORN	☐ MISUSED	☐ MARRED
CUSTOMER'S REQUEST	rifle firing when safety was released				

MAIN FAULT

- 1) Trigger pull adjusted too light (2½# below spec) out of factory
- 2) Trigger assembly contaminated with excessive lubrication; internal parts not moving freely. Trigger reaction is not consistent.

Rifle operates acceptably at room temperature, however, cold temperatures could cause problems.

ART	Per phone call to customer on 10/16/90 -				
	1) replace trigger assembly with new one at ½ normal price (based on approx. rfb)				
	2) adjust trigger pull to 3½ - 4#				
	3) return rifle C.O.D.				
	4) please expedite & ship asap.				
REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

RD6925 REV. 6/86

OFFICE COPY