

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700
 GENERAL CONDITION: NEW R #: _____
 OUTSIDE WORK: NO DATE: 3-3-75
 _____ FROM: _____
 FIRED AMMO TYPE: - _____
 & CONDITION: _____ GUN #: 6356761
 PROOF: R.E.P.-E INSP.: 74 TEST: 13 CODE: OT = 7/70
 HEADING: ? GA./CAL.: 25-06 REM.
 BREECH OPENING: _____ CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

FIRING PIN HEAD GUIDE SLOT NOT CENTERED
WITH HOUSING SLOT. FIRING PIN HEAD POORLY
CHAMFERED.

COMPLAINT: SAFETY MALFUNCTION

INCIDENT: FIRING PIN HEAD CATCHES ON LEFT SIDE OF
HOUSING (PROTRUDING INTO SLOT) SO THAT ACTION
WILL NOT FIRE AS TRIGGER IS PULLED UNTIL BOLT
HANDLE IS LIFTED.

COMMENTS: _____
RECEIVER MEASURED EDGE OF FIRING PIN HEAD
GUIDE SLOT TO SIDE OF HOUSING SLOT
RIGHT SIDE = .073, LEFT SIDE = .056