

BARBER - Kinzer PPS GAL RE0005697

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: MOHAWK 600
 GENERAL CONDITION: NEW R #: _____
 OUTSIDE WORK: SCOPE MOUNTED DATE: 3-3-75
 FROM: _____
 FIRED AMMO TYPE: _____
 & CONDITION: _____ GUN #: 6651698
 PROOF: R.E.P.-B INSP.: U TEST: 13 CODE: OX = 7/73
 HEADING: _____ GA./CAL.: 6MM REM.
 BREECH OPENING: _____ CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

FIRING PIN HEAD GUIDE SLOT NOT CENTERED WITH
HOUSING SLOT. REAR LEFT CORNER OF HOUSING UPSET
BY ASSEMBLER ATTEMPT TO RELIEVE THE INTERFERENCE
BETWEEN FIRING PIN HEAD AND HOUSING. SEAR BINDING
ON BURR.

COMPLAINT: SAFETY MALFUNCTION

INCIDENT: FIRING PIN HEAD CATCHES ON LEFT SIDE OF HOUSING
(PROTRUDING INTO SLOT) SO THAT ACTION WILL NOT FIRE AS
TRIGGER IS PULLED, UNTIL BOLT HANDLE IS LIFTED.

COMMENTS: RECEIVER MEASURED, EDGE OF FIRING PIN
GUIDE SLOT TO SIDE OF HOUSING SLOT.

RIGHT SIDE = .072 LEFT SIDE = .054