

Remington Arms Co., Inc.
Product Service
Legal Case #:1976

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
139328	1/8/2008	1/9/2008	1/9/2008				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter		Thomas	Bormes	2209 Ky Rt 122	Printer	KY	41655		H 606-285-5061 E ttom1937@yahoo.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038	Could Not Duplicate Concern		
S	Concern:1008	Fired on Bolt Closing	Unknown	
C	Fired on bolt closing			

1/10/08-correspondence from repair-gun fired when bolt closed.lw

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPR	20000	6581665	OW	7/1/1972
Date Purchased	Where Purchased	Accessories	Original Owner			
	OSCAR ROBBINS PITTSBURGH PA		U			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Replace TA under SMP						
	Repair/Replacement Cost	Repair/Replacement Date				

1/10/08-quote sent to replace TA under smp.lw

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/9/2008
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		22" 3006 SPR
	Date Code		OW
	Bore Plugged	False	
	Bulged	False	
	Fired	False	

	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Worn; Functioning	SOME CRATERING FROM LEAKING PRIMERS
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.006
	Notch	Like new; Functioning	DIRTY
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	---Select---	4.5#
	Altered	True	SOME RED SEALANT OVER SEAR ENGAGE SCREW,BUT THERE APPEARS NOT TO BE ANY CHANGE
	Sub-Assembly	M/700 Bolt Lock	

1976



General Repair Form

Back to Repair Services

NOTE: Please complete and print this form, and then include it with your firearm

OW 7/72
45#
1006

Model Number: 700		Serial Number: 6581665	
Name: Col. Thomas J. Bormes ret		Date of Purchase: 2007 used	
Address (no PO Boxes): 2209 KY Rt. 122			
City: Printer		State: KY	Zip: 41655
Phone (Daytime): (606) 285-5061		Fax:	
E-mail Address: ttom1937@yahoo.com			
<p>Please describe your problem:</p> <p>Gun fired when I closed the bolt.</p>			
467 characters left			
<p>NOTE: Prior to shipping your firearm, contact the Repair Center for services provided and estimated repair time.</p>			
<p>Ⓢ WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM.</p> <ul style="list-style-type: none"> :: Record the serial number of your firearm before sending it. :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.) :: Remove all accessories from your firearm to prevent loss or damage. :: Ship your ENSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier. 			

Serial Number: 6581665

Model: 700



RE00139328

about Us Visit Our Other Remington Websites Other Sites

could not duplicate concern.
Replace TPA, check over, clean
under bolt local program
Ron B 20.00. + S+H
a note

repair_form.asp 12/26/200