

Remington Arms Co., Inc.
Product Service
Legal Case #:3337

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
164756	3/17/2009	3/18/2009	3/18/2009				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter		R. W.	Fulford	7123 Howard Ave Ext	Rocky Mount	NC	27801		

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S fired after releasing safety	Concern:1007 Fired on Safe Release			
C				

3/23/09 per letter with rifle, when the cartridge is cahmbered adn the safety is pushed to fire, gun discharges. Has happened several times. Overtravel screw was reoved in an attempt to adjust. Screw will now only go back in 1/2 way then stops.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/2506 REM	26907	T6261138	KW	5/15/2002 6:19:10 PM
Date Purchased	Where Purchased	Accessories	Original Owner			
	JERRY S SPORT INC		U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
repair at 1/2 normal charges						
	Repair/Replacement Cost	Repair/Replacement Date				
	62.25	3/23/2009				

3/23/09 The trig assem is contaminated with a foreign supstance causing the trigger to work sluggish. Replace TPA, check over, clean at 1/2 normal charges.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		3/18/2009
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4015	Improper Maintenance	SET SCREWS ALTERED
	Description		24" 2506 REM

Barrel	Date Code		KW
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
Bolt	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
Extractor	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
Locking	Ext/Eject Test	False	
	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
Magazine	Notch Condition	---Select---	
	Condition	---Select---	
Overall	Box Condition	Missing	
	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
Receiver	Fore End Condition	---Select---	
	Condition	Slightly Worn; Functioning	
Safety	Bulged	False	
	Description		STANDARD M/700 SAFETY
	Function	Like new; Functioning	
Sear	Sub-Assembly	ISS	
	Lift	---Select---	N/A
	Notch	Slightly Worn; Functioning	
Feeding Test	Tests	Test Fired	False
		False	
Trigger	Condition	Slightly Worn; Not Functioning	
	Pull	---Select---	6#
	Altered	True	SET SCREWS ALTERED OVER TRAVEL SCREW MISSING
	Sub-Assembly	M/700 Non-Bolt Lock	

RECEIVED
MAR 23 2009
BY: _____

March 1, 2009

333724"
6"

R. W. FULFORD
7123 Howard Ave Ext.
Rocky Mount, NC 27801

} Return address
after repair

Model 700, chambered 25-06.

Safety issue with rifle. When cartridge chambered & safety pushed to fire, gun discharges. Has happened several times.

Overtravel screw was removed in attempt to adjust. Screw will now only go back in $\frac{1}{2}$ way then stops.

Please repair & return.

RW Fulford

T6261138

Model: 700



RE00164756

T1219. ASSM. is contaminated with
a foreign substance causing
T1219 to work sluggish.
replace TPA, check over, clean
At 1/2 normal charges.

Quote

35.25
15
12

62.25