Remington Arms Co., Inc. **Product Service** Legal Case #:3567

Case Information

Date Opened Date Opened(PS) RE# **Date Closed Incident Date** Obsolete Pre Lit Lit

169994 6/24/2009 6/25/2009 6/25/2009

Customer Information

Type **Business** First Name Last Name Street City State Zip Age Contact H 410-749-4732

321 Carey Ave Incident Gerald McCabe Salisbury 21804 MD E gtmccabe 1943@comcast.net

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

Ы

 \mathbf{C}

PD Cause:4038 Could Not Duplicate Concern

Unknown

S fires on safe release

Concern:1007 Fired on Safe Release

6/26/09 Per letter with rifle, discharges (not always) when you push the safety off. 1st time was in early 80's on hunting trip. He had a local gunsmith clean trigger assm and it worked fine for a few years. It started discharging again when you pushed the safety off. He had a local gunsmith clean and set trigger pull. It worked fine for a few years again. This past hunting season it started discharging again. Wants

repaired.cm

Firearm Information

Mfg. Model/Ga. SKU Type Serial Bbl. DOM CF/BA 700/3006 SPR 20000 B6275419 LB 2/17/1981 Remington

Date Purchased Where Purchased Original Owner Accessories

ANDERSON IRELAND BALTIMORE MD U

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Cash Reim. Date Cash Date Settlement Release of Claims Release Date Reimbursement Settlement APV APV

replace TPA at BLSP price of

\$20 + S&H

Repair/Replacement Repair/Replacement

Cost Date


6/26/2009 78.03

6/26/09 Per Supry, could not duplicate concern. Trig adjusting screws altered. Replace TPA, check over under BLSP for \$20 + \$&H.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		6/25/2009
Examination	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4006	Altered Adjustments or Components	

	Description		22" 3006 SPR
Barrel	Date Code	1	LB
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		-
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	Select	.007
	Notch	Like new; Functioning	
	Toots	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	Select	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	

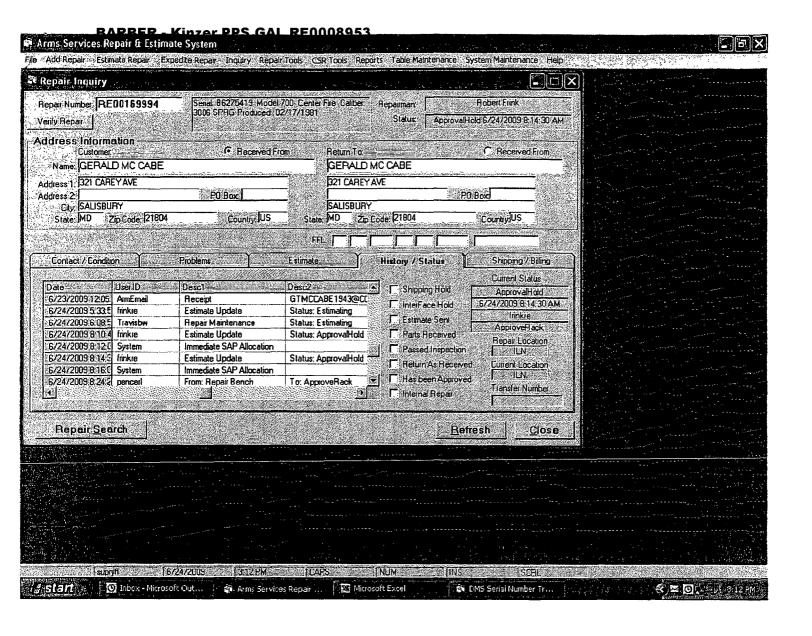

\$20.53 15. 35. 17.50 12. — 15. 15. 37. 78.03



Back to Repair Services

22" 2.5th LB 2/81

General Repair Form

NOTE: Please complete and print this form, and then include it with your firearm

Model Number: 700	Serial Number: B6	Serial Number: B6275419					
Name: Gerald McCabe	Date of Purchase: N/A						
Address (no PO Boxes): 321 Carey Ave.							
City: Salisbury	State: MD	Z ip: 21804					

Fax:

Phone (Daytime): 410-749-4732

E-mail Address: gtmccabe1943@comcast.net

Please describe your problem:

Discharges (not always) when you push the safety off. First time was in early 80's on hunting trip. I had a local gunsmith clean trigger assly and it worked fine for a few years. It started discharging again when you pushed the safety off, I had a local gunsmith clean and set trigger pull. It worked fine for few years. This past hunting season it started discharging again. Please repair.

Thanks, Gerald McCabe

36 characters left

NOTE: Prior to shipping your firearm, contact the Repair Center for services provided and estimated repair time.

① WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM.

- :: Record the serial number of your firearm before sending it.
- : Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.)
- :: Remove all accessories from your firearm to prevent loss or damage.
- Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.

© 2009 Remington Arms Company, Inc. All Rights Reserved.

Investor Relations | Other Remington Brand Products | Legal Notices | About Us

Remington

B6275419

Model: 700

RE00169994

Visit Our Other Websites

Other Sites

rould pot duplicate concern.

Tizig. Adjusting screws Altered.

Replace TPA, check over, under

Bolt Louic program ford 20.00

+ S+H.

Quate

http://www.remington.com/support/repair_services/general_repai... 6/18/2009