

Remington Arms Co., Inc.
Product Service
Legal Case #:2893

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
155596	11/19/2008	11/20/2008	11/25/2008				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Bob	Petta	1007 W College Ave #534	Santa Rosa	CA	95404		H 707-477-1391

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S	fired on bolt closing	Concern:1008 Fired on Bolt Closing		
C				

11/26/08 According to letter with rifle, his rifle discharged when closing the bolt. He repeated the action several times with the same result.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/270 WIN	20000	B6205733	CA	4/30/1980
Date Purchased	Where Purchased	Accessories	Original Owner			
	K MART ENT SPARKS NV	BOTTOM HALF OF SEE THRU SCOPE MOUNTS	U			

CONCRN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
repair at special price under BLSM program						
	Repair/Replacement Cost	Repair/Replacement Date				
	45.00	11/26/2008				

11/26/08 Trig dirty & sticky, causing sear to bind to sideplates. Check over, clean, replace TPA under BLS for \$20 + s&H.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		11/20/2008
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4015	Improper Maintenance	
Barrel	Description		22" 270 WIN
	Date Code		CA
	Bore Plugged	False	
	Bulged	False	
	Fired	False	

	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.009
	Notch	Slightly Worn; Not Functioning	SLUGGISH/BINDING
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY STICKY SEAR SLUGGISH/BINDING
	Pull	---Select---	5.5#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		BOTTOM HALF OF SEE THRU SCOPE MOUNTS

2893

~~2893~~

CA 4/80
22"
S.S.H
009

November 8, 2008

ATTENTION: SERVICE DEPARTMENT

From: Bob Petta
1007 West College Avenue
#534
Santa Rosa, CA 95404

I spoke with your service department after my rifle discharged when I closed the bolt. I repeated the action several times with the same result. I was instructed to mail you the rifle.

Model # 700
Serial # B6205733
Please call me if you have any questions. 707-477-1391

TRIG. DIRTY AND STICKY, CAUSING
SEAR TO BIND TO SIDE PLATES.
checked, clean, replace TPA
under BOLT LOCK PROGRAM
ROR \$ 20.00 + SHIP
Quote

Serial
Number:

B6205733

Model: 700



RE00155596