Remington Arms Co., Inc. Product Service Legal Case #:4656

Case Information

RE# Date Opened Date Opened(PS) Date Closed Incident Date Pre Lit Lit Obsolete
199797 8/3/2010 8/3/2010 8/5/2010

Customer Information

Type Business First Name Last Name Street City State Zip Age Contact W 303-350-6775 4431 Mesa Verde Dr. Reporter James Armstrong Greeley CO 80634 C 970-443-2131

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

ΡI

FSR

PD Cause: 4006 Altered Adjustments or Components

Concern:1007 Fired on Safe Release

Unknown

S C

Did not duplicate the FSR concern but, did get the firing pin to release closing the bolt extremely hard. fls

Firearm Information

 Mfg.
 Type
 Model/Ga.
 SKU
 Serial
 Bbl.
 DOM

 Remington
 CF/BA
 700/2506
 n/a
 6849207
 CZ
 4/1/1975

 Data Burghesed
 Accessories
 Original Gunner

Date Purchased Where Purchased Accessories Original Owner

BERNS WHLS DENVER COLORADO U

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date Reimbursement Cash Reim. Date Cash Date
Settlement APV APV

Quoting for Bolt Lock Modification

Repair/Replacement
Cost
S60.23

Cepair/Replacement
Date
8/5/2010

Quoting bolt lock modification. fls


Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment		
	Examiner		supry		
	Exam Date		8/3/2010		
	Product Type		RF		
	Action Type		A		
	Assigned To		Supry		
Cause	4006		As received the trigger pull was below factory specifications. Trigger screw backed out so far that the trigger would not reliably return under the sear.		
	Description		22 inch 2506		
	Date Code		CZ		
	Bore Plugged	False	·		
	Bulged	False			
	Fired	False			
	Fired while Obstructed				
	Muzzle/Crown	Slightly Worn;			

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=4656&Type=Case

8/5/2010

	Condition	Functioning	_	
Bolt	Firing Pin	Worn; Functioning	7	
	Shroud	Worn; Functioning	j	
	Face	Slightly Worn;		
		Functioning		
	Handle	Slightly Worn; Functioning		
	Stop	Slightly Worn; Functioning		
Extractor	Condition	Slightly Worn; Functioning		
	Cut Condition	Slightly Worn; Functioning		
	Ext/Eject Test	True	]	
	Block Condition	Select		
Locking	Lug Condition	Slightly Worn; Functioning		
	Notch Condition	Select		
	Condition	Select	<u> </u>	
Magazine	Box Condition	Slightly Worn; Functioning		
	Exterior Condition	Worn; Functioning		
Overall	Stock Condition	Worn; Functioning		
	Fore End Condition	Select		
Receiver	Condition	Slightly Worn; Functioning		
L	Bulged	True	Ī	
	Description	]	Model 700 Bolt Lock	
Safety	Function	Abused; Functioning	]	
	Sub-Assembly	Non-ISS		
	Lift	Select	not measured	
Sear	Notch	Slightly Worn; Functioning		
		Condition	Abused; Functioning	
Pull	]	Select	2.25 lbs	
Altered	Trigger	True	]	
Sub- Assembly		M/700 Bolt Lock		

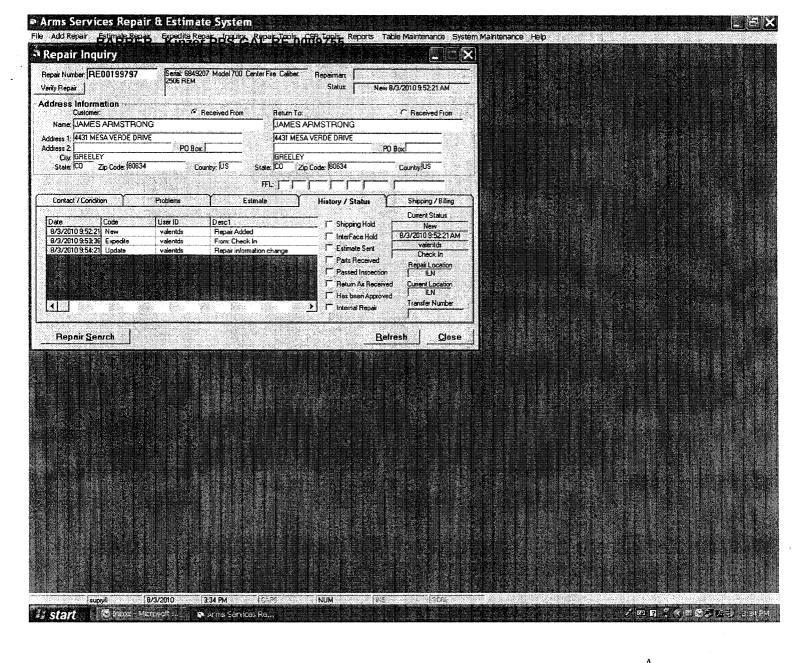

	Albert Trigger screws. the
	trigger is loose screw not
PECELVE AUG - 4 2010	tight enough to return trigger
BY:	under sear reliabily.
	TRED 8/3/10
	4

BARBER - Kinzer PPS GAL RE 0009756

JAMES ARMSTRONG 4431 MESA VERDE DR. GREELEY, CO 80634

cel:970-443-2131

Wk: 303-350-6775

**6849207** 

Model: 700

When Gun is loaded and a shell chambered, the gun will actually fire the round when you take the safety off. It does not do it every time but I have been able to re-create the issue after multiple attempts. Please contact me with any questions.

Sincerely James Armstrong

Thank you In advance

Duote for both lock modification

TREO 8/3/10



