Remington Arms Co., Inc. Product Service Legal Case #:4695

Case Information

Incident Date RE# **Date Opened** Date Opened(PS) **Date Closed** Pre Lit Lit Obsolete 201218 8/24/2010 8/25/2010 8/25/2010

Customer Information

City First Name Last Name Street Contact Type Business State Zip Age H 970-222-3476 1902 Lookout Ln Incident Powell Fort Collins CO 80526 Joel E jpowell61@gmail.com

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

PΙ

PD Cause: 4006 Altered Adjustments or Components has fired when taking safety Concern: 1007 Fired on Safe Release

Unknown

S

8/27/10 Per note with rifle, Powell wanted to send the gun in for the Bolt Lock Safety Modification. The gun has discharged once when taking the safety off to open the bolt.cm

Firearm Information

Model/Ga. SKU Serial Bbl. DOM Mfg. Type 700/308 WIN CF/BA 20000 141458 3/1/1965 AM Remington Where Purchased **Original Owner Date Purchased** Accessories U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Cash Cash Reim. Settlement Release of Claims Release Date Reimbursement Date Settlement Date APV APV

Per Ilion, replace TPA, check, clean under BLSM price of \$20 + S&H

Repair/Replacement Repair/Replacement

Cost

45.23

Date 8/27/2010

8/27/10 Per Ilion, safety not working properly, it is not raising sear properly. Replace TPA, check over, clean under bolt lock program for \$20 + S&H.cm


Examination[Remington/CF/BA]

Code Comment Sub-Part Part **B.TRAVIS** Examiner Exam Date 8/25/2010 RF Examination Product Type Action Type Assigned To F.SUPRY Altered Adjustments or Components Cause 4006 22" 308 WIN Description Date Code AM Barrel False Bore Plugged Bulged False

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=4695&Type=Case

8/31/2010

ı	ller a	False	1
	Fired	raise	
	Fired while Obstructed		··············
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Slightly Worn; Not Functioning	
Sear	Lift	Select	.001
	Notch	Slightly Worn; Functioning	
	Tosto	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Functioning	SAFETY NOT WORKING
	Pull	Select	2.5#
	Altered	True	TRIG PULL ALTERED
	Sub-Assembly	M/700 Bolt Lock	

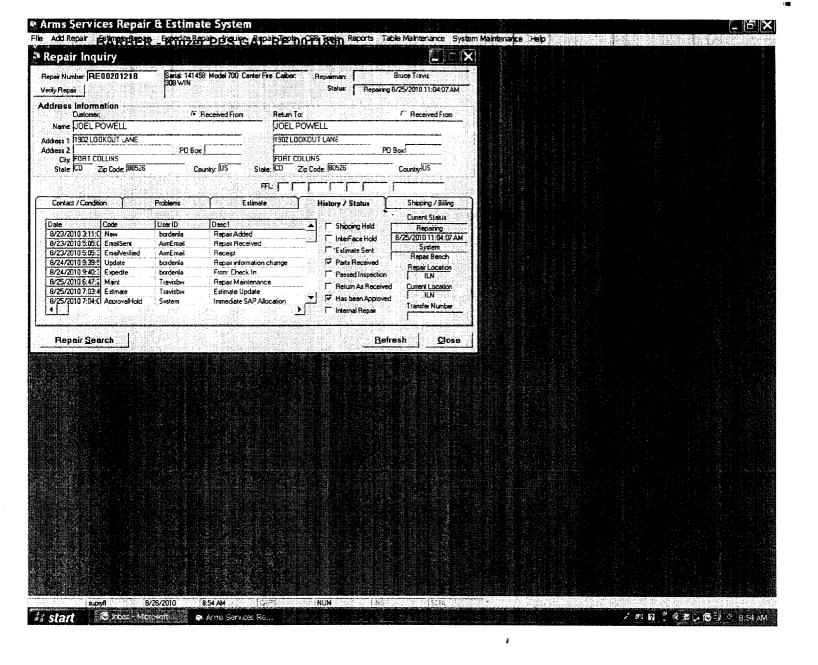

27. -20.23 35. \$\frac{1}{2}.23 37.

DECEIVE AUG 2 7 2010 BY: 4695

Please describe your problem:

Want to send gun in for the Bolt Lock Safety Modification, gun has discharged once when taking safety off to open the bolt.

Safety Not work, ug properly, it is not raising sear properly. Replace TPA, check over, clear under bolt Lock program for \$ 20.00 + 5+4.

Quote

377 characters left

NOTE: Prior to shipping your firearm, contact the Repair Center for services provided and estimated repair time.

141458

Model: 700



RE00201218

VE OR SPENT SHELLS IN YOUR < WITH THE FIREARM. THIS IS A YOU FEEL YOU MUST SEND SPENT SEPARATE PACKAGE AND INCLUDE E), TELEPHONE AND MODEL AND OF YOUR FIREARM.

your firearm before sending it. prevent further damage in shipping and erably, ship in a

:: Remove all accessories from your firearm to prevent loss or damage.
:: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss

during shipment, so you may elect to purchase insurance from your carrier.

"Print_{si}

Reset

http://www.remington.com/asp/general_repair_form.asp

8/17/2010