

BARBER - Kinzer PPS GAL RE 0013037 Remington Arms Co., Inc.
Product Service
Legal Case #:5298

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
212382	12/3/2010	12/6/2010	12/6/2010				X

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Adrian	Perkins	7686 Rte 53	Kanona	NY	14856		H 607-329-1430

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006 Altered Adjustments or Components		Unknown	
S	Fired on safety release Concern:1007 Fired on Safe Release			
C				

12/16/10 Per note with rifle, if you set the bolt pull the trigger with the safety on, remove your finger from the trigger and take safety off it will fire more times than not.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	710/270 WIN	27408	71312792	PA	6/27/2006 4:30:41 AM
Date Purchased	Where Purchased	Accessories	Original Owner			
	WAL-MART SUPERCENTER 3221		U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/710/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace trigger assm, clean at 1/2 normal cost						

Repair/Replacement Cost	Repair/Replacement Date

12/16/10 Per Ilion, Trigger assm set screws altered. Replace TPA, check over, clean and test fire at 1/2 normal cost.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/6/2010
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	
Barrel	Description		22" 270 WIN
	Date Code		PA
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	

BARBER - Kinzer PPS GAL RE 0013038

Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Magazine	Condition	---Select---	
	Box Condition	Slightly Worn; Functioning	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/710 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	
	Notch	Like new; Functioning	
	Trigger	Condition	Slightly Worn; Functioning
Pull		---Select---	2.2#
Altered		True	SET SCREWS ALTERED
Sub-Assembly		Other Remington	

22"
PA 6/06
2.2[#]

5295

From: Adrian Perkins
7686 RTE 53
KANOONA, NY 14856

ATTEN: TOM NAGLE

THIS 710 HAS HAD ABOUT
5 ROUNDS FIRED THROUGH IT


IF YOU SET THE Bolt
with the trigger with SAFE ON,
REMOVE FINGER FROM TRIGGER
AND TAKE SAFETY OFF IT ~~with~~
WILL FIRE MORE TIMES THAN NOT

Questions call:

607-329-1430

71312792

Model: 710

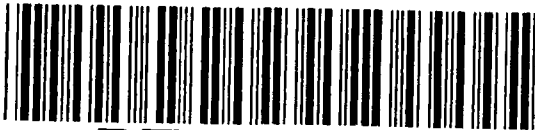

RE00212382

T.A. set screws altered.

Replace TPA, check over, clean &
Test fire AT 1/2 normal cost.

nagletj - ILN/Prod frmRepairMain NAGLETJ Monday, Dec 6 2010 1:56 PM

