

cc: R.L. Hall
C.B. Workman
W.E. Leek

File under Safety
REMINGTON ARMS COMPANY, INC.

INTER-DEPARTMENTAL CORRESPONDENCE

Committee
Remington



March 26, 1975

Tom
John E. Bennett
RECEIVED

MAR 27 1975

E. G. LARSON

TO: E.G. LARSON

FROM: G.W. MARTIN

SUBJECT: MOHAWK 600'S AT CARTER'S IN HOUSTON, TEXAS

The safety was checked on a total of 354 rifles.

We used three (3) methods, as follows:

- A. Safety was placed in "mid" position, trigger was then pulled, and then the safety was released.
- B. Safety was placed in "mid" position, trigger was pulled, safety was then placed on safe, and the safety was next released.
- C. Safety was in fully on position, trigger pulled (very hard), and safety was released. *Note: This check was not made on first five (5) guns - reason, Bill Carter was checking these.

Results:

Total guns unable to "trick".....	39
Total guns "tricked" by A or B (above).....	154
Total guns "tricked" by both A and B	152
Total guns "tricked" by C.....	4
	<u>349</u>
	+ 5
	<u>354</u>

Grand total-315 rifles out of 354 could be tricked.

Codes for 350 rifles.

CU Apr. 71.....	23
KU May 71.....	2
AW Mar. 72.....	7
PX June 73.....	3
OX July 73.....	23
RX Nov. 73.....	43
XX Dec. 73.....	175
BY Jan. 74.....	31
CY Apr. 74.....	2
DY Sept. 74.....	41
	<u>350</u>

RECEIVED

MAR 31 1975

OFFICE - E. F. BARRETT

(continued)

REMINGTON ARMS COMPANY, INC.

INTER-DEPARTMENTAL CORRESPONDENCE



-2-


SUBJECT: MOHAWK 600'S AT CARTER'S IN HOUSTON, TEXAS

Codes for the four (4) rifles that would fire by "C" method:

RX Nov. 73.....	2
XX Dec. 73.....	1
BY Jan. 74.....	<u>1</u>
	4

Les Freer, Houston Gunsmith, was contacted. He repairs the 600 in one or two ways. He said that sometimes it is just a matter of trigger adjustment and other times it needs a new safety. Les said that prior to 1973 repairs of this nature were rare.

Sincerely,


G.W. Martin Supervisor
Firearms Product Service

GWM:tpp