REMINGTON ARMS COMPANY, INC.

Field Service Bpt., Conn.

RECOLEMINED GUNSMITH CALL REPORT

m EWELL CROSS SUN SHOP			_ Reporte	er <u>F. V. Wo</u>	ດດ້ານຈັດໄດ້	Date J 25, 71		
lress	4101 East Rosedale Street		Fort Wort	h. Towas Stat		Zip _7(5105	
e of	Business <u>Sele & re</u>	<u> </u>	· · · · · · · · · · · · · · · · · · ·	_Dealer (%) Large (χ) Small	- () _.	
csons	Interviewed ::	TropI) Or	10 3 T	P	osition 0-			
·····		•			•			
		GEN	ERAL DIS	CUSSION				
had a	This shop performs a few problems that 2 1788's that would	have not	; been on	.countéred	before:			

had a few problems that have not been encountered before:
Had 2 M788's that would fire with the safety on-one from a Sibson Store
pich was Serial 1938672, 30/30 and one from Mash Have stock-a M788 6011
5003736 Sede COE4-installed new fire controls in both and will return
the defective ones to Ilion.

Montion was made of three 19705's misfiring-the only thing In. Cross did to then was to adjust the bolt plug so they would thread in a half-turn more advised this uses not govern the firing pin protrusion-calthough stated no more difficulty was encountered with then.

In the last two months have had about eight M1100's in which the gas cylinder has come loose from the barrel assembly. This past year has had about a 100 or more feed latchs breaking.

Had a M591 in which the bolt latch tip was broken off-replacement corrected it so it worked properly-another in which the fired shell would not come out of the chamber-fired case showed narks from the chamber so recommended it be returned to the factory for SPECIFIC PROBLEMS barrel chamber check.

Past year have had about a dozen M700's that close hard over the shell—usually adjustment of extractor corrects the condition—also about eight to ten trigger connectors breaking—usually only efter the customer has fired a few shots—(these fire controls have not been touched) also stleast twice the above number when they have been adjusted by the customer improperly.