

GUNSMITH CALL REPORT

30: 1010 1010 1010

Date 1.1.1972 Reporter E. Goodrich
 Gunsmith's Name E. J. Smith
 No. & Street 100 6th Street City Minneapolis State Min. Zip 55403
 On Premises? X If not, give address below:
 Gunsmith's Address _____
 No. & Street _____ City _____ State _____ Zip _____
 Model List () Open Acct. () 50% Disc. _____ Dealer () Large () Small ()
 INTERVIEWED and POSITION:
E. J. Smith, Gunsmith (2) _____
 (4) _____

PROBLEMS ENCOUNTERED:

2 M100 extra barrels that the piston & seal would not go into until smoothed up.

DISCUSSION

Mr. Smith reported this past summer has had two M100 extra barrels that would not properly fit where the rings would go into the gas cylinder until he smoothed the cylinders. Today had a M76 in a box in which an attempted repair had been made on the trigger assembly along with the early style trigger, cocking lever which did not have enough clearance for release of the trigger. Also a M740 with a jamming problem which was corrected. During my visit a customer brought in a M700 in which he stated would fire when taken out the safe about once in twenty rounds. This gun was carefully checked out & found nothing wrong--good coverage on the rear & connector--came to the conclusion the customer was evidently holding his finger on the trigger & not realizing it as it could not be made to fire or jar off in any manner tested. Was complimentary on our good past service for within three weeks the guns are resolved back here--none of the others come close to this service.