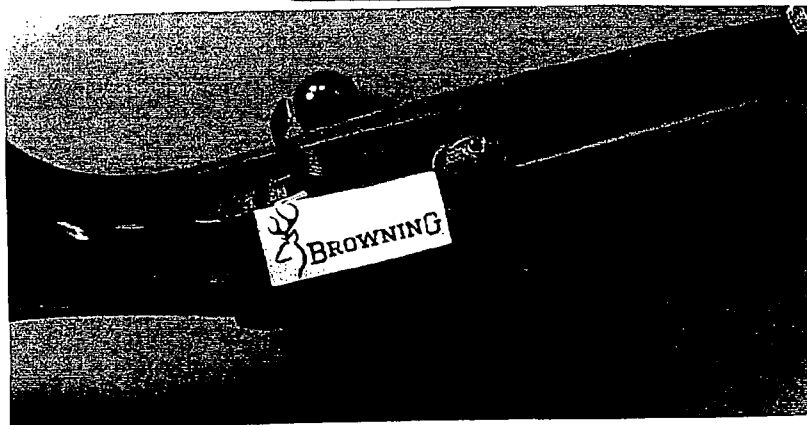


-17-

VIII. Browning BBR Continued

The bolt would ride over the top of the cartridges. The rifle was taken apart and examined. An improperly factory installed spring escutcheon that the screw screwed into was the cause of the feeding problem. The spring escutcheon was halfway out of the hole and the wood around the hole was chipping away. The Model Shop tried to repair it, but they were unable to do so. (Figs. No. 4 & 5)

Fig. No. 4Fig. No. 5