

NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 ADL
GENERAL CONDITION: GOOD R #: 027716
OUTSIDE WORK: SCOPE MOUNTED, ALL SEALS DATE: 1-4-73
BROKEN ON TRIGGER ASSEMBLY FROM: DUNHAM'S
FIRED AMMO TYPE: _____ MEDFORD, OREGON
& CONDITION: _____ GUN #: 369419
PROOF: R.E.P. INSP.: ASSEMBLER 13 TEST: ? CODE: DR = 9/68
HEADING: O.K. EX./CAL.: 3006
BREECH OPENING: _____ CHECKED BY: C. PROSSER
RECOIL SHOULDERS: O.K. APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: NO APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

HARDENED LUBRICANT CAUSING TRIGGER BIND. TRIGGER
STOP SCREW OUT OF POSITION BINDING IN CONNECTOR.

COMPLAINT: FIRES ON RELEASING SAFETY

INCIDENT: FOLLOW DOWN

COMMENTS: THE OUT OF POSITION STOP SCREW HOLDS THE
TRIGGER CONNECTOR IN FIRED POSITION CAUSING
FOLLOW DOWN.

PLAINTIFF'S
EXHIBIT

3186

141
AL 0029716