

No GUN EXAMINATION REPORT NUMBER: _____

GENERAL CONDITION: NEW

OUTSIDE WORK: SCOPE MOUNTED

FIRED AMMO TYPE: _____

& CONDITION: _____

PROOF: REP-D INSP. 74 TEST: 55

HEADING: _____

BREACH OPENING: _____

RECOIL SHOULDERS: O.K.

CHAMBER: O.K.

TEST: No

COMPONENT CONDITION: (Damaged, Broken, Old Style)

MODEL: 700 BDL

R #: 027443

DATE: 12-22-72

FROM: KAYTON MFG. CO.

ALLENTOWN, PA.

GUN #: 6241978

CODE: KS = 5/69

GA./CAL.: 243

CHECKED BY: C. PROSSER

APPROVED: _____

APPROVED: _____

APPROVED: _____

APPROVED: _____

SEAR - TRIGGER CONNECTOR ENGAGEMENT OK. TRIGGER
BINDING IN HOUSING. LUBRICATION LIKE GREASE ON
SEAR

COMPLAINT: FIRES WHEN SAFETY IS PUSHED OFF.

INCIDENT: FOLLOW DOWN.

COMMENTS: THE LUBRICANT USED PROBABLY CAUSED
SLUGGISH TRIGGER-CONNECTOR-SEAR RETRACTION
INTO COCKED POSITION, RESULTING IN FOLLOW DOWN.

PLAINTIFF'S
EXHIBIT

3188

AL 0029718