

I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 BDL
 GENERAL CONDITION: NEW R #: 026826
 OUTSIDE WORK: SCOPE MOUNTED DATE: 12-18-72
 FROM: DICK'S SPT. SHOP
 FIRED AMMO TYPE: _____ STAHLSTONN, PA.
 & CONDITION: _____ GUN #: 6223531
 PROOF: R.E.P. INSP. ? TEST: 87 CODE: AS = 3/69
 HEADING: O.K. GRA./CAL.: 3006
 BREACH OPENING: - CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

SEAR-TRIGGER CONNECTOR ENGAGEMENT .015 (MIN.
15.020) BURRS ON SEAR AND TRIGGER. TRIGGER
1.074 (MODEL DRAWING = 1.076) CONNECTOR 1.081 (1.080)
1.079) 1.083)
SAFETY CENTER OF PIVOT TO TOP OF CAM .290 (.292)
.296)

COMPLAINT: "MISFIRES WHEN HE PUSHES THE SAFE OFF"

INCIDENT: FOLLOW DOWN

COMMENTS: FOLLOW DOWN COULD HAVE BEEN DUE TO
BURRS BINDING AND PREVENTING RETRACTION OR
EXCESSIVE CONNECTOR-TRIGGER CLEARANCE
ALLOWING THE CONNECTOR TO WORK UP TO INTERFERE
WITH THE SEAR WHICH THE SAFETY DID NOT LIFT
ENOUGH TO CLEAR.

PLAINTIFF'S
EXHIBIT

3193

AL 0029723