

Cust. Copy
 1. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 ADL
 GENERAL CONDITION: GOOD R #: 024437
 OUTSIDE WORK: SCOPE MOUNTED, RECOIL PAD DATE: 11-22-72

ADDED FROM: DONALDSON'S GUN SHOP
 FIRED AMMO TYPE: _____ MINNEAPOLIS, MINN.
 & CONDITION: _____ GUN #: 309624
 PROOF: R.E.P. ASSEMBLER 63 INSP.: 96 TEST: 87 CODE: EP = 10/67
 HEADING: O.K. GA./CAL.: 3006
 BREACH OPENING: _____ CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

CONNECTOR CLEARANCE ON TRIGGER .003 UNDER MIN.
BURRS ON SIDES OF TRIGGER HOUSING PROTRUDES
INTO FIRING PIN HEAD SLOT, SEAR-TRIGGER CONNECTOR
ENGAGEMENT .025

COMPLAINT: FIRE UPON LOCKING THE BOLT.

INCIDENT: FOLLOW DOWN

COMMENTS: THE CUSTOMER'S MALEFUNCTION CAN NOT BE
DUPLICATED AND THERE IS NO EVIDENCE OF SUCH
MALEFUNCTION. HOWEVER, THE TRIGGER BURRS,
EXCESSIVE TRIGGER-TRIGGER CONNECTOR CLEARANCE,
AND HOUSING PROTRUDING COULD CONTRIBUTE -
SUCH A MALEFUNCTION.

PLAINTIFF'S
EXHIBIT

3201

AL 0029731